Euro NCAP Test 2022:
BMW X1

Fünf Sterne für den BMW X1

Das Fahrzeug ist mit Gurtkraftbegrenzern, Gurtstraffern, Kopfairbags sowie optischen und akustischen Gurtwarnern in der ersten und zweiten Sitzreihe mit Sitzplatzbelegungserkennung ausgestattet. In der ersten Sitzreihe schützen Airbags den Oberkörper und das Becken zusätzlich seitlich. Zwischen den Sitzen ist ein Zentralairbagsystem installiert, das die vorderen Insassen bei einem Seitenaufprall gegeneinander schützt.



Der BMW X1 im frontalen Offsetcrash gegen die gleichschnell und versetzt entgegenrollende Barriere mit Deformationselement (Foto: Euro NCAP)

Der Insassenschutz ist insgesamt gut, das Verletzungsrisiko für Erwachsene ist sehr gering bis hoch, für Kinder sehr gering bis gering. Es sind ISOFIX-Halter an den beiden äußeren Sitzplätzen der zweiten Sitzreihe sowie am Beifahrersitz serienmäßig montiert mit i-Size-Kennzeichnung. Die gegurtete Montage ist auf allen Sitzplätzen für vom Hersteller freigegebene Kindersitze unkritisch. Der Frontairbag auf der Beifahrerseite ist deaktivierbar.

Der BMW X1 ist mit einem autonomen Notbremsassistenten mit Erkennung ungeschützter Verkehrsteilnehmer, mit aktivem Spurhaltesystem und mit einem automatisierten Geschwindigkeitsbegrenzer serienmäßig ausgestattet. Eine Multikollisionsbremse ist an Bord. Ein e-Call-Notrufsystem ist serienmäßig verbaut. Ein ISO-konformes Rettungsdatenblatt („Rettungskarte“) steht zur Verfügung.

Insassenschutz für Erwachsene: 86 %

Die Fahrgastzelle des X1 blieb beim versetzten Frontalaufpralltest stabil. Die Dummy-Werte zeigten einen guten Schutz der Knie und Oberschenkel von Fahrer und Beifahrer. BMW wies nach, dass Fahrer unterschiedlicher Größe und Sitzposition ein ähnliches Schutzniveau erfahren. Jedoch könnten Strukturen im Armaturenbrett ein Verletzungsrisiko für das äußere Bein von Beifahrern unterschiedlicher Größe darstellen. Der Schutz des Brustkorbs des Fahrers wurde auf der Grundlage der Kompressionswerte des Dummys als schwach eingestuft. Die Analyse der Abbremsung des gleichschnell entgegenrollenden Aufprallwagens während des Tests und die Analyse der verformbaren Barriere nach dem Test ergaben, dass der X1 bei einem Frontalaufprall ein mäßig guter Aufprallpartner sein würde. Beim Test gegen die starre Barriere über die gesamte Fahrzeugbreite wurde der Schutz der Brust für den hinteren weiblichen Insassen als gering eingestuft, während die anderen kritischen Körperbereiche gut geschützt waren und der Schutz für den Fahrer gut oder ausreichend war.

Sowohl beim Test mit der seitlich eindringenden Barriere als auch beim schwereren seitlichen Pfahlanprall war der Schutz aller kritischen Körperbereiche gut, das Fahrzeug erhielt in diesem Teil der Bewertung die maximale Punktzahl. Die Begrenzung der Auslenkung (das Maß, in dem ein Körper bei einem Seitenaufprall auf die andere Seite des Fahrzeugs geschleudert wird) wurde als ausreichend bewertet. Der X1 verfügt über eine Gegenmaßnahme (Zentralairbagsystem), die Verletzungen der vorderen Insassen untereinander bei solchen Aufprallen verhindert. Das System schnitt im Euro NCAP-Test gut ab und schützte die Köpfe der Insassen gut. Tests an den Vordersitzen und Kopfstützen zeigten einen guten Schutz gegen Schleudertraumata bei einem Heckaufprall. Eine geometrische Analyse der Rücksitze ergab ebenfalls einen guten Schleudertrauma-Schutz. Der X1 verfügt über ein modernes e-Call-System, das im Falle eines Unfalls die Rettungsdienste alarmiert. Das Auto verfügt auch über ein System, das nach einem Aufprall die Bremsen betätigt, um Folgekollisionen zu vermeiden.

Insassenschutz für Kinder: 89 %

Sowohl beim versetzten Frontalaufprall als auch beim Seitenaufprall zeigten die Dummymesswerte einen guten oder ausreichenden Schutz aller kritischen Körperbereiche für beide Kinderdummys an. Der Beifahrerairbag kann deaktiviert werden, um die Verwendung eines rückwärtsgerichteten Kindersitzes auf diesem Sitzplatz zu ermöglichen. Der Fahrer erhält klare Informationen über den Status des Airbags. Alle Rückhaltesysteme, für die der X1 ausgelegt ist, konnten ordnungsgemäß eingebaut und untergebracht werden.

Ungeschützte Verkehrsteilnehmer: 76 %

Der X1 hat eine „aktive" Motorhaube. Sensoren im Stoßfänger erkennen, wenn ein Fußgänger angefahren wird, und Aktuatoren heben die Oberfläche der Motorhaube leicht an, um mehr Freiraum zu den steifen Strukturen im Motorraum zu schaffen. BMW wies nach, dass das System in der Lage ist, verschiedene Fußgängergrößen bei unterschiedlichen Geschwindigkeiten zu erkennen, und so wurde das Fahrzeug in der angehobenen Position getestet.

Der Kopfschutz auf der Motorhaube war fast durchweg gut, nur am unteren Rand der Windschutzscheibe und an den steifen A-Säulen wurden einige ungenügende Ergebnisse erzielt. Der Stoßfänger bot einen guten Schutz für die Beine der Fußgänger, der Schutz des Beckenbereichs war an allen Teststellen ungenügend. Das autonome Notbremssystem (AEBS) des X1 kann sowohl auf ungeschützte Verkehrsteilnehmer als auch auf andere Fahrzeuge reagieren. Bei Tests zur Reaktion auf Fußgänger und Radfahrer schnitt das System gut ab, wobei in den meisten Szenarien Kollisionen vermieden wurden.

Sicherheits-Assistenten: 92 %

Das autonome Notbremssystem (AEBS) des X1 hat bei Tests zur Reaktion auf andere Fahrzeuge gut abgeschnitten. Ein Anschnall-Erinnerungssystem ist serienmäßig auf den Vorder- und Rücksitzen angebracht. Das Fahrzeug verfügt über ein System zur Erkennung von Fahrermüdigkeit. Der Spurhalteassistent korrigiert sanft die Fahrspur, wenn das Fahrzeug von der Spur abweicht, und greift auch in kritischeren Situationen ein. Das Geschwindigkeitsassistenzsystem erkennt die örtliche Geschwindigkeitsbegrenzung, der Fahrer kann wählen, ob die Höchstgeschwindigkeit des Fahrzeugs automatisch vom System festgelegt werden soll.

Herausgeber/Impressum

ADAC e.V.
Test und Technik
81360 München
E-Mail tet@adac.de
www.adac.de

Euro NCAP
www.euroncap.com

BMW X1

Standard Safety Equipment

2022



Adult Occupant: 86%

Child Occupant: 89%

Vulnerable Road Users: 76%

Safety Assist: 92%

SPECIFICATION

Tested Model	BMW X1 2.0 diesel X-Line, LHD
Body Type	- 5 door SUV
Year Of Publication	2022
Kerb Weight	1654kg
VIN From Which Rating Applies	- all X1's
Class	Small Off-Road

Version 071022

SAFETY EQUIPMENT

	Driver	Passenger	Rear
FRONTAL CRASH PROTECTION			
Frontal airbag	●	●	–
Belt pretensioner	●	●	●
Belt loadlimiter	●	●	●
Knee airbag	✖	✖	–
LATERAL CRASH PROTECTION			
Side head airbag	●	●	●
Side chest airbag	●	●	✖
Side pelvis airbag	●	●	✖
Centre Airbag	●	●	–

Version 071022

SAFETY EQUIPMENT (NEXT)

	Driver	Passenger	Rear
CHILD PROTECTION			
Isofix/i-Size	—	●	●
Integrated CRS	—	✖	✖
Airbag cut-off switch	—	●	—
SAFETY ASSIST			
Seat Belt Reminder	●	●	●

OTHER SYSTEMS	
Active Bonnet	●
AEB Vulnerable Road Users	●
AEB Pedestrian - Reverse	✖
AEB Car-to-Car	●
Speed Assistance	●
Lane Assist System	●

Note: Other equipment may be available on the vehicle but was not considered in the test year.

● Fitted to the vehicle as standard ○ Fitted to the vehicle as part of the safety pack

○ Not fitted to the test vehicle but available as option or as part of the safety pack ✖ Not available — Not applicable

Version 071022

ADULT OCCUPANT

Total 32.8 Pts / 86%

GOOD ADEQUATE MARGINAL WEAK POOR

Frontal Impact 11.0 / 16 Pts





Mobile Progressive Deformable Barrier



Full Width Rigid Barrier

Lateral Impact 16.0 / 16 Pts




Side Mobile Barrier



Side Pole



Far-Side Excursion

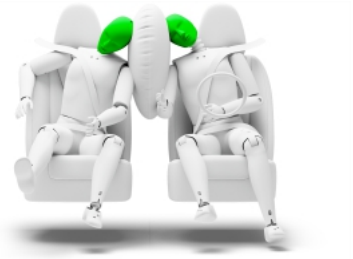

Occupant Interaction

Rear Impact 3.7 / 4 Pts



Rear Seat



Front Seat

Version 071022

ADULT OCCUPANT

Total 32.8 Pts / 86%

GOOD ADEQUATE MARGINAL WEAK POOR

Rescue and Extrication	2.0 / 2 Pts
Rescue Sheet	Available, ISO compliant
Advanced eCall	Available
Multi Collision Brake	Available

Comments

The passenger compartment of the X1 remained stable in the frontal offset test. Dummy numbers demonstrated good protection of the knees and femurs of both the driver and passenger. BMW showed that a similar level of protection would be provided to drivers of different sizes and to those sitting in different positions but that structures in the dashboard might present a risk of injury to the outboard leg of differently-sized front passengers. Driver chest protection was rated as weak, based on dummy readings of compression. Analysis of the deceleration of the impact trolley during the test, and analysis of the deformable barrier after the test, revealed that the X1 would be a moderately benign impact partner in a frontal collision. In the full-width rigid barrier test, chest protection was rated as marginal for the rear passenger, with good protection of other critical body areas, and was good or adequate for the driver. In both the side barrier test and the more severe side pole impact, protection of all critical body areas was good and the car scored maximum points in this part of the assessment. Control of excursion (the extent to which a body is thrown to the other side of the vehicle when it is hit from the far side) was found to be adequate. The X1 has a counter-measure to mitigate against occupant to occupant injuries in such impacts. The system performed well in Euro NCAP's test, with good protection of occupants' heads. Tests on the front seats and head restraints demonstrated good protection against whiplash injuries in the event of a rear-end collision. A geometric analysis of the rear seats also indicated good whiplash protection. The X1 has an advanced eCall system which alerts the emergency services in the event of a crash. The car also has a system which applies the brakes after an impact to avoid secondary collisions.

Version 071022

CHILD OCCUPANT

Total 43.9 Pts / 89%

GOOD ADEQUATE MARGINAL WEAK POOR

Crash Test Performance based on 6 & 10 year old children

23.9 / 24 Pts

Frontal Impact	15.9 Pts



Lateral Impact	8 Pts



Restraint for 6 year old child: *Britax Römer KidFix SL*
Restraint for 10 year old child: *Osann Up*

Safety Features

8.0 / 13 Pts

	Front Passenger	2nd row outboard	2nd row center
Isofix	●	●	✖
i-Size	●	●	✖
Integrated CRS	✖	✖	✖

● Fitted to test car as standard ○ Not on test car but available as option ✖ Not available

Version 071022

CRS Installation Check

12.0 / 12 Pts

Install without problem | Install with care | Safety critical problem | Installation not allowed

i-Size CRS

Maxi Cosi 2way Pearl & 2wayFix (i-Size)



Maxi Cosi 2way Pearl & 2wayFix (i-Size)



BeSafe iZi Kid X2 i-Size (i-Size)



Britax Römer TriFix2 i-Size (i-Size)



BeSafe iZi Flex FIX i-Size (i-Size)



ISOFIX CRS

BeSafe iZi Combi X4 ISOfix (ISOFIX)



Cybex Solution Z i-Fix (ISOFIX)



Version 071022

CHILD OCCUPANT

Total 43.9 Pts / 89%

- **Universal Belted CRS**

Maxi Cosi Cabriofix (Belt)



Maxi Cosi Cabriofix & EasyFix (Belt)



Britax Römer King II LS (Belt)



Cybex Solution Z i-Fix (Belt)



CHILD OCCUPANT

Total 43.9 Pts / 89%

	Seat Position			
	Front	2nd row		
	PASSENGER	LEFT	CENTER	RIGHT
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	●	●	—	●
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	●	●	—	●
BeSafe iZi Kid X2 i-Size (i-Size)	●	●	—	●
Britax Römer TriFix2 i-Size (i-Size)	●	●	—	●
BeSafe iZi Flex FIX i-Size (i-Size)	●	●	—	●
BeSafe iZi Combi X4 ISOfix (ISOFIX)	●	●	—	●
Cybex Solution Z i-Fix (ISOFIX)	●	●	—	●
Maxi Cosi Cabriofix (Belt)	●	●	●	●
Maxi Cosi Cabriofix & EasyFix (Belt)	●	●	✖	●
Britax Römer King II LS (Belt)	●	●	●	●
Cybex Solution Z i-Fix (Belt)	●	●	●	●

● Install without problem ● Install with care ● Safety critical problem ✖ Installation not allowed

— Not available

Comments

In both the frontal offset test and the side barrier impact, dummy readings indicated good or adequate protection of all critical body areas for both child dummies The front passenger airbag can be disabled to allow a rearward-facing child restraint to be used in that seating position. Clear information is provided to the driver regarding the status of the airbag and the system was rewarded. All of the restraint types for which the X1 is designed could be properly installed and accommodated.

Version 071022

VULNERABLE ROAD USERS

Total 41.1 Pts / 76%

GOOD ADEQUATE MARGINAL WEAK POOR

Pedestrian

25.5 / 36 Pts



Head Impact	19.3 Pts
Pelvis Impact	0.2 Pts
Leg Impact	6.0 Pts

Vulnerable Road Users

15.6 / 18 Pts

System Name	Person Warning with City Braking Function
Type	Auto-Brake with Forward Collision Warning
Operational From	5 km/h

VULNERABLE ROAD USERS


Total 41.1 Pts / 76%

AEB Pedestrian


6.9 / 9 Pts

- **Day time**


Vehicle reversing into standing pedestrian

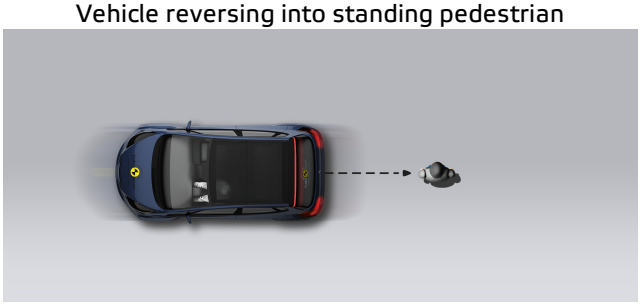


Pedestrian crossing a road into which a car is turning

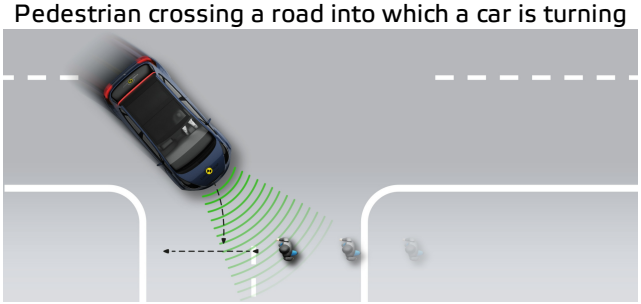


Adult crossing the road

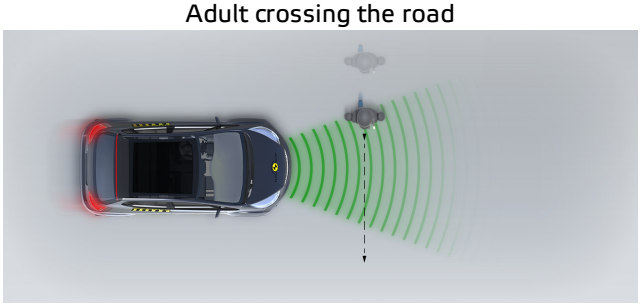

Child running from behind parked vehicles

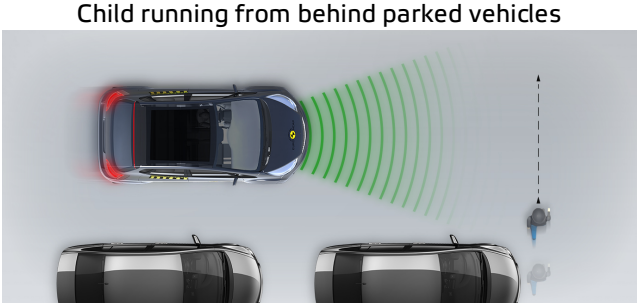


Adult along the roadside

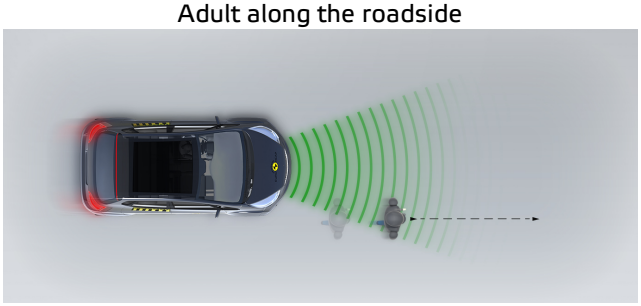


- **Night time**

Adult crossing the road

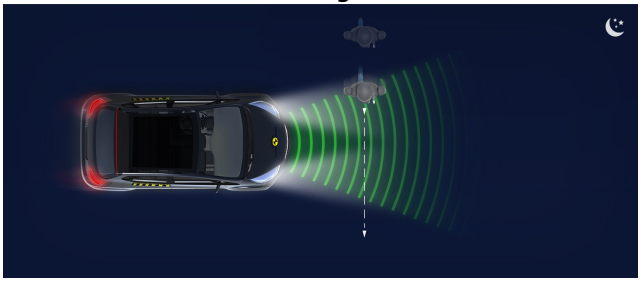

Adult along the roadside

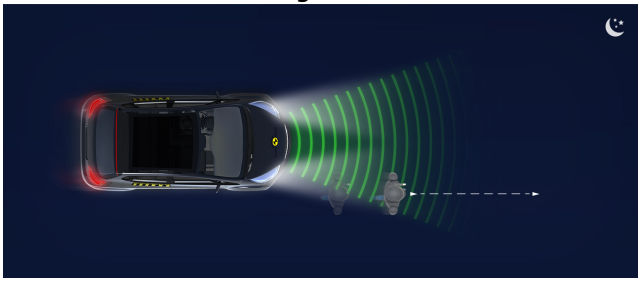

Version 071022


VULNERABLE ROAD USERS

Total 41.1 Pts / 76%


AEB Cyclist

8.7 / 9 Pts


Cyclist from nearside, obstructed view

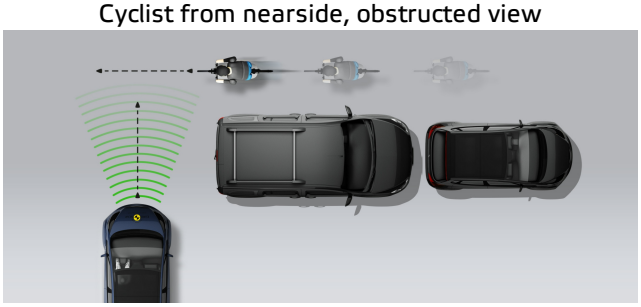

Cyclist crossing

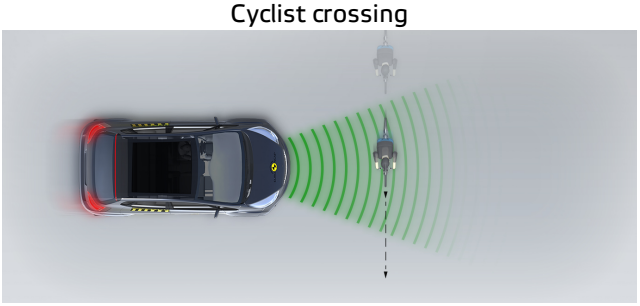

Cyclist along the roadside

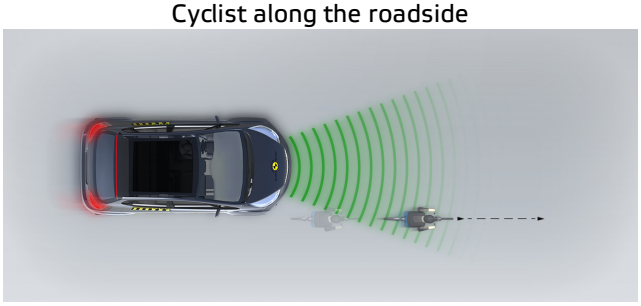

Comments

The X1 has an ‘active’ bonnet. Sensors in the bumper detect when a pedestrian has been struck and actuators lift the surface of the bonnet to provide greater clearance to the stiff structures in the engine compartment. BMW showed that the system was capable of detecting various pedestrian statures over a range of speeds and, accordingly, the car was tested in the raised, ‘deployed’ position. Head protection on the bonnet surface was almost entirely good, with some poor results recorded at the base of the windscreen and on the stiff windscreen pillars.. The bumper offered good protection to pedestrians’ legs but protection of the pelvis region was poor for all test locations. The autonomous emergency braking (AEB) system of the X1 can respond to vulnerable road users, as well as to other vehicles. The system performed well in tests of its response to pedestrians and cyclists, with collisions avoided in most scenarios.

Version 071022

SAFETY ASSIST

Total 14.8 Pts / 92%

GOOD ADEQUATE MARGINAL WEAK POOR

Speed Assistance

2.8 / 3 Pts

System Name	Speed Limit Assist
Speed Limit Information Function	Camera & Map, subsigns supported
Speed Limitation Function	System advised (accurate to 5km/h)

Occupant Status Monitoring

3.0 / 3 Pts

Seatbelt Reminder

2.0 / 2 Pts

Applies To	Front and rear seats		
Warning	Driver Seat	Front Passenger(s)	Rear Passenger(s)
Visual	●	●	●
Audible	●	●	●
Occupant Detection	—	●	●

● Pass ● Fail — Not available

Driver Monitoring

1.0 / 1 Pts

System Name	Attentiveness Assistant
Type	Indirect: time-on-task, steering input
Operational From	70 km/h

Version 071022

SAFETY ASSIST

Total 14.8 Pts / 92%

Lane Support

3.5 / 4 Pts

System Name	Lane Departure Warning with Steering Intervention
Type	LKA and ELK
Operational From	60 km/h
PERFORMANCE	
Emergency Lane Keeping	GOOD
Lane Keep Assist	GOOD
Human Machine Interface	GOOD

AEB Car-to-Car

5.5 / 6 Pts

System Name	Collision Warning with Braking Function
Type	Autonomous emergency braking and forward collision warning
Operational From	5 km/h
Sensor Used	camera and radar


Version 071022

SAFETY ASSIST


Total 14.8 Pts / 92%

- **Autobrake function only**


Test car turns across the path of an approaching car

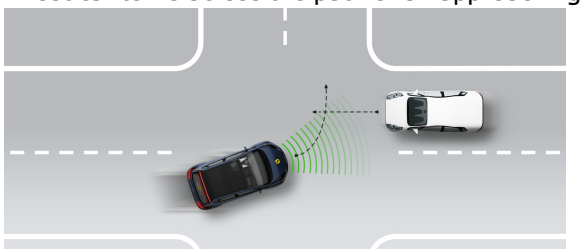


Approaching a stationary car

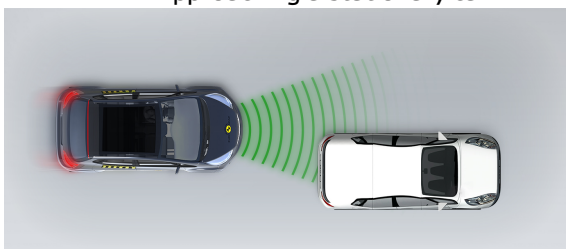


Approaching a stationary car

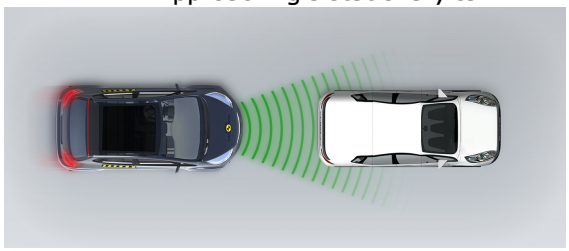


Approaching a stationary car

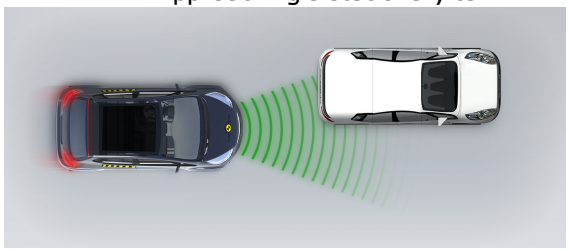


Approaching a slower moving car

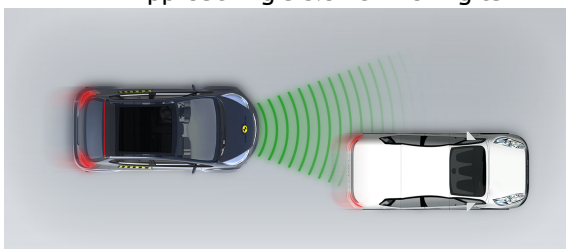


Approaching a slower moving car

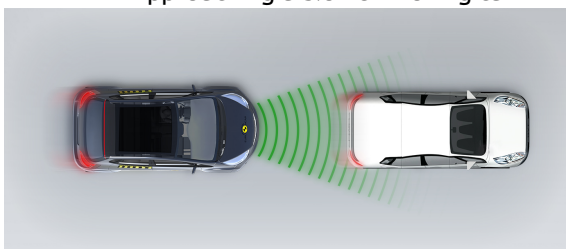

Approaching a slower moving car

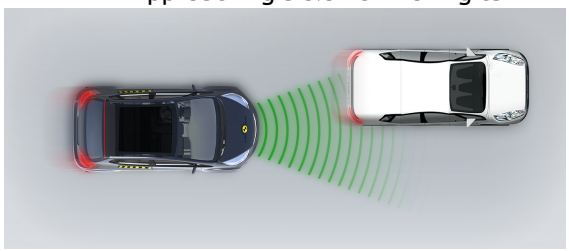

Approaching a braking car

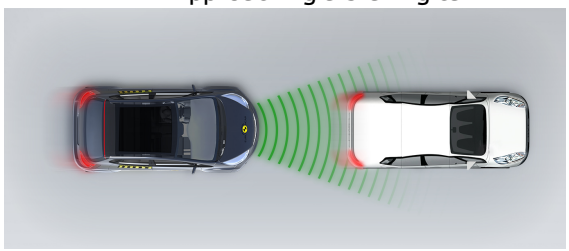


SAFETY ASSIST


Total 14.8 Pts / 92%

- **Driver reacts to warning**


Approaching a stationary car

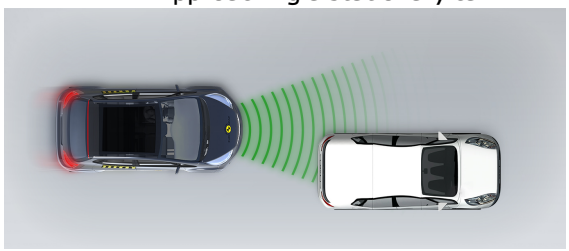


Approaching a stationary car

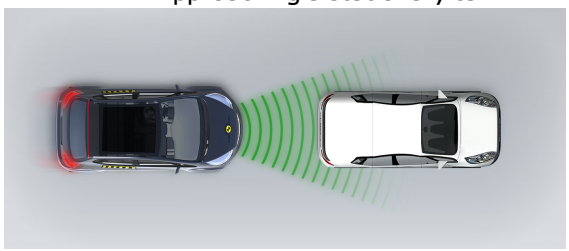


Approaching a stationary car

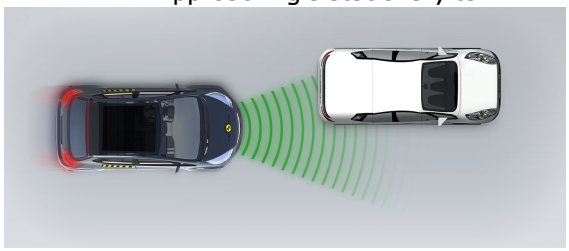


Approaching a slower moving car

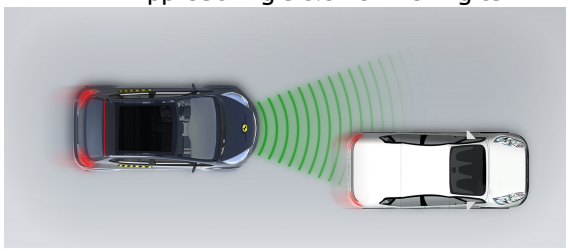


Approaching a slower moving car

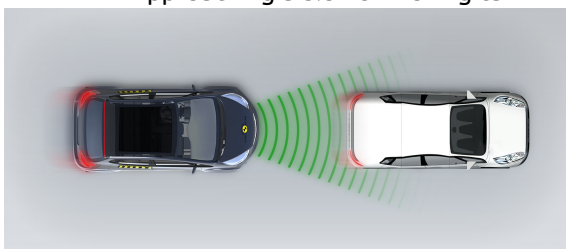

Approaching a slower moving car

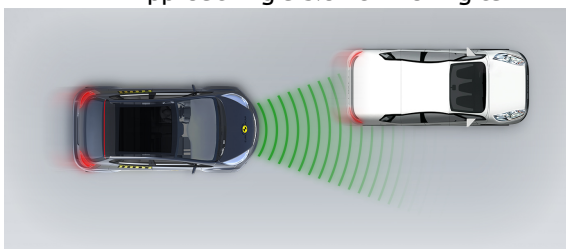

Approaching a braking car

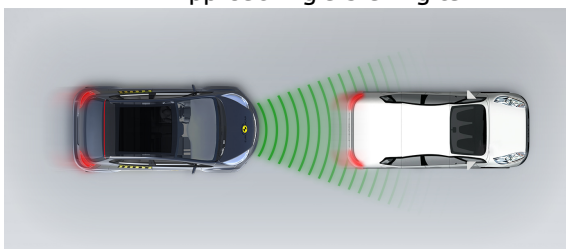

Version 071022

SAFETY ASSIST

Total 14.8 Pts / 92%

Comments

The X1's autonomous emergency braking (AEB) system performed well in tests of its reaction to other vehicles. A seatbelt reminder system is fitted as standard to the front and rear seats and the car has a system to detect driver fatigue. The lane support system gently corrects the vehicle's path if it is drifting out of lane, and also intervenes in some more critical situations. The speed assistance system detects the local speed limit and the driver can choose to allow the maximum speed of the car to be automatically set by the system.

Version 071022

RATING VALIDITY

Variants of Model Range

Body Type	Engine	Model Name/Code	Drivetrain	Rating Applies	
				LHD	RHD
5 door SUV	2.0 diesel	X1 sDrive 18d*	4 x 2	✓	✓
5 door SUV	2.0 diesel	X1 xDrive 20d	4 x 4	✓	✓
5 door SUV	2.0 diesel	X1 xDrive 23d	4 x 4	✓	✓
5 door SUV	1.5 petrol	X1 sDrive 18i	4 x 2	✓	✓
5 door SUV	1.5 petrol	X1 sDrive 20i	4 x 2	✓	✓
5 door SUV	2.0 petrol	X1 xDrive 23i	4 x 4	✓	✓

* Tested variant

Annual Reviews and Facelifts

Date	Event	Outcome	
October 2022	Rating Published	2022 ★★★★★	✓

Version 071022