

## Euro NCAP Test 2022: BMW 2er Coupé

### Vier Sterne für den BMW 2er Coupé

Das Fahrzeug ist mit Gurtkraftbegrenzern, Gurtstraffern, Kopfairbags sowie optischen und akustischen Gurtwarnern in der ersten und zweiten Sitzreihe mit Sitzplatzbelegungserkennung für den Beifahrersitz ausgestattet. In der ersten Sitzreihe schützen Airbags den Oberkörper zusätzlich seitlich. Zwischen den Sitzen ist *kein* Zentralairbagsystem installiert, das die vorderen Insassen gegeneinander schützen könnte.

Der Insassenschutz ist gut, das Verletzungsrisiko für Erwachsene sehr gering bis gering, für Kinder sehr gering bis hoch. Es sind ISOFIX-Halter an den beiden Sitzplätzen der zweiten Sitzreihe montiert mit i-Size-Kennzeichnung. Die gegurtete Montage ist auf allen Sitzplätzen für vom Hersteller zugelassene Kindersitze unkritisch. Der Frontairbag auf der Beifahrerseite ist deaktivierbar.

Der BMW 2er Coupé ist mit einem autonomen Notbremsassistenten mit Erkennung ungeschützter Verkehrsteilnehmer, mit aktivem Spurhaltesystem, mit einem automatisierten Geschwindigkeitsbegrenzer und mit einer Fahreraufmerksamkeitserkennung serienmäßig ausgestattet. Ein e-Call-Notrufsystem ist serienmäßig an Bord. Ein ISO-konformes Rettungsdatenblatt („Rettungskarte“) steht zur Verfügung.



Der BMW 2er Coupé im frontalen Offsetcrash gegen die rollende Barriere mit Deformationselement (Foto: Euro NCAP)

### Insassenschutz für Erwachsene: 82 %

Die Fahrgastzelle des 2er Coupé blieb im versetzten Frontalaufpralltest stabil. Die Dummy-Werte zeigten einen guten Schutz der Knie und Oberschenkel von Fahrer und Beifahrer. BMW zeigte, dass Insassen unterschiedlicher Größe auf unterschiedlichen Sitzposition ein ähnliches Schutzniveau angeboten wird. Die Analyse der Verzögerung des Aufprallwagens während des Tests und die Analyse der verformbaren Barriere nach dem Test ergaben, dass das 2er Coupé bei einem Frontalaufprall ein aggressiver Aufprallpartner sein würde. Beim Test gegen die starre Barriere über die gesamte Breite wurden alle kritischen Bereiche des Körpers sowohl für den Fahrer als auch für den kleinen Insassen auf dem Rücksitz gut oder ausreichend geschützt.

Beim Test mit der seitlich eindringenden Barriere war der Schutz aller kritischen Bereiche der Karosserie gut, und das Fahrzeug erreichte in diesem Teil der Bewertung die maximale Punktzahl. Beim schwereren seitlichen Pfahlanprall war der Schutz aller kritischen Bereiche des Körpers gut oder ausreichend. Die Kontrolle der Auslenkung (d. h. des Maßes, in dem ein Körper auf die Stoßseite des Fahrzeugs geschleudert wird, wenn es auf der dem Insassen abgewandten Seite getroffen wird) wurde als mäßig eingestuft. Das 2er Coupé verfügt nicht über eine Gegenmaßnahme, wie z. B. einen Zentralairbag, um Verletzungen der Insassen bei einem solchen Aufprall zu verhindern. Tests an den Vordersitzen und Kopfstützen zeigten einen guten Schutz gegen Schleudertraumata bei einem Heckaufprall. Eine geometrische Analyse der Rücksitze ergab ebenfalls einen guten Schleudertrauma-Schutz. Das 2er Coupé verfügt über ein e-Call-System, das im Falle eines Aufpralls die Rettungskräfte alarmiert, aber kein System zur Verhinderung von Sekundäraufprallen.

### Insassenschutz für Kinder: 81 %

Beim seitlichen Aufprall ergaben die Messungen der Kopfbeschleunigungen des 10-jährigen Dummies einen schwachen Schutz. Ansonsten war der Schutz aller kritischen Körperbereiche gut, sowohl für den 10-jährigen als auch für den 6-jährigen Testdummy. Der Beifahrer-Airbag kann deaktiviert werden, um die

Verwendung eines rückwärtsgerichteten Kindersitzes auf dieser Sitzposition zu ermöglichen. Der Fahrer erhält klare Informationen über den Status des Airbags. Alle Kinderrückhaltesysteme, für die das 2er Coupé ausgelegt ist, konnten ordnungsgemäß eingebaut und im Fahrzeug untergebracht werden.

## **Ungeschützte Verkehrsteilnehmer: 67 %**

Das 2er Coupé hat eine „aktive“ Motorhaube. Sensoren im Stoßfänger erkennen, wenn ein Fußgänger angefahren wird, und Aktuatoren heben die Motorhaube leicht an, um einen größeren Abstand zu harten Strukturen im Motorraum zu bieten. BMW hat gezeigt, dass das System bei verschiedenen Fußgängergrößen und über einen großen Geschwindigkeitsbereich hinweg zuverlässig funktioniert, weshalb das Fahrzeug mit hochgestellter Motorhaube getestet wurde.

Der Kopfschutz war über fast die gesamte Fläche der Motorhaube gut. Der Stoßfänger schützte die Beine der Fußgänger nur an den äußersten Testpunkten gut. Der Schutz des Beckens war jedoch fast vollständig ungenügend. Das serienmäßige autonome Notbremssystem kann sowohl schwächere Verkehrsteilnehmer als auch andere Fahrzeuge erkennen. Bei den Tests zur Reaktion auf Fußgänger zeigte das System eine ausreichende Leistung, wobei in vielen Szenarien Kollisionen vermieden oder abgemildert werden konnten. Bei Tests zur Reaktion auf Radfahrer war die Leistung des Systems schwach.

## **Sicherheits-Assistenten: 64 %**

Bei Tests zur Reaktion auf andere Fahrzeuge zeigte das autonome Notbremssystem eine ausreichende Leistung. Ein Spurhaltesystem korrigiert sanft die Lenkung, wenn das Fahrzeug von der Spur abweicht, und kann in einigen anderen, kritischeren Situationen auch energischer eingreifen.

Das Geschwindigkeitsassistenzsystem kann die örtliche Geschwindigkeitsbegrenzung erkennen und zeigt sie dem Fahrer an, so dass der Geschwindigkeitsbegrenzer entsprechend eingestellt werden kann. Ein Gurtwarnsystem ist für alle Sitzplätze serienmäßig.

### Herausgeber/Impressum

ADAC e.V.  
Test und Technik  
81360 München  
E-Mail [tet@adac.de](mailto:tet@adac.de)  
[www.adac.de](http://www.adac.de)

Euro NCAP  
[www.euroncap.com](http://www.euroncap.com)



## BMW 2 Series Coupé

Standard Safety Equipment

2022



Adult Occupant



82%

Child Occupant



81%

Vulnerable Road Users



67%

Safety Assist



64%

## SPECIFICATION

Tested Model	BMW 2 Series Coupé, 2.0 diesel, RHD
Body Type	- 2 door coupe
Year Of Publication	2022
Kerb Weight	1682kg
VIN From Which Rating Applies	- all 2 Series Coupés
Class	Small Family Car

## SAFETY EQUIPMENT

	Driver	Passenger	Rear
<b>FRONTAL CRASH PROTECTION</b>			
Frontal airbag	●	●	✗
Belt pretensioner	●	●	●
Belt loadlimiter	●	●	●
Knee airbag	✗	✗	✗
<b>LATERAL CRASH PROTECTION</b>			
Side head airbag	●	●	●
Side chest airbag	●	●	✗
Side pelvis airbag	✗	✗	✗
Centre Airbag	✗	✗	—

Euro NCAP © BMW 2 Series Coupé March 2022 2/18

## SAFETY EQUIPMENT (NEXT)

---

		Driver	Passenger	Rear
CHILD PROTECTION				
Isofix	—	✗	●	
Integrated CRS	—	✗	✗	
Airbag cut-off switch	—	●		—
SAFETY ASSIST				
Seat Belt Reminder	●	●	●	

OTHER SYSTEMS	
Active Bonnet	●
AEB Vulnerable Road Users	●
AEB Pedestrian - Reverse	✗
AEB Car-to-Car	●
Speed Assistance	●
Lane Assist System	●

Note: Other equipment may be available on the vehicle but was not considered in the test year.

● Fitted to the vehicle as standard

○ Fitted to the vehicle as part of the safety pack

○ Not fitted to the test vehicle but available as option or as part of the safety pack

✗ Not available

— Not applicable



## ADULT OCCUPANT

Total 31.3 Pts / 82%

GOOD

ADEQUATE

MARGINAL

WEAK

POOR

## Frontal Impact

13.0 / 16 Pts




Mobile Progressive Deformable Barrier

Full Width Rigid Barrier

## Lateral Impact

13.3 / 16 Pts

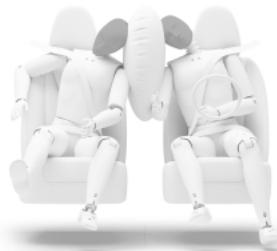

Side Mobile Barrier

Side Pole

Far-Side Excursion

Occupant Interaction

## Rear Impact

4.0 / 4 Pts



Rear Seat



Front Seat

**ADULT OCCUPANT**

Total 31.3 Pts / 82%

 GOOD   
  ADEQUATE   
  MARGINAL   
  WEAK   
  POOR

Rescue and Extrication		1.0 / 2 Pts
Rescue Sheet	Available, ISO compliant	
Advanced eCall	Available	
Multi Collision Brake	Not available	

**Comments**

The passenger compartment of the 2 Series Coupé remained stable in the frontal offset test. Dummy numbers showed good protection of the knees and femurs of both the driver and passenger. BMW showed that a similar level of protection would be provided to occupants of different sizes and to those sitting in different positions. Analysis of the deceleration of the impact trolley during the test, and analysis of the deformable barrier after the test, revealed that the 2 Series Coupé would be an aggressive impact partner in a frontal collision. In the full-width rigid barrier test, good or adequate protection was provided to all critical body areas, for both the driver and rear passenger. In the side barrier test, protection of all critical body areas was good and the car scored maximum points in this part of the assessment. In the more severe side pole impact, protection of all critical body areas was good or adequate. Control of excursion (the extent to which a body is thrown to the other side of the vehicle when it is hit from the far side) was found to be marginal. The 2 Series Coupé does not have a countermeasure, such as a centre airbag, to mitigate against occupant-to-occupant injuries in such impacts. Tests on the front seats and head restraints demonstrated good protection against whiplash injuries in the event of a rear-end collision. A geometric analysis of the rear seats also indicated good whiplash protection. The 2 Series Coupé has an advanced eCall system which alerts the emergency services in the event of a crash, but does not have a system to prevent secondary impacts after the car has been in a collision.

**CHILD OCCUPANT**

Total 40.1 Pts / 81%

 GOOD ADEQUATE MARGINAL WEAK POOR

Crash Test Performance based on 6 &amp; 10 year old children

22.1 / 24 Pts

Restraint for 6 year old child: *Britax Römer Kidfix SL*Restraint for 10 year old child: *Osann Up booster cushion***Safety Features**

6.0 / 13 Pts

	Front Passenger	2nd row outboard
Isofix	✗	●
i-Size	✗	●
Integrated CRS	✗	✗

● Fitted to test car as standard

○ Not on test car but available as option

✗ Not available

## CRS Installation Check

12.0 / 12 Pts

 Install without problem Install with care Safety critical problem Installation not allowed

## ■ i-Size CRS

Maxi Cosi 2way Pearl &amp; 2wayFix (i-Size)



Maxi Cosi 2way Pearl &amp; 2wayFix (i-Size)



BeSafe iZi Kid X2 i-Size (i-Size)



Britax Römer TriFix2 i-Size (i-Size)



BeSafe iZi Flex FIX i-Size (i-Size)



## ■ ISOFIX CRS

BeSafe iZi Combi X4 ISOfix (ISOFIX)



Cybex Solution Z i-Fix (ISOFIX)





## CHILD OCCUPANT

Total 40.1 Pts / 81%

## ■ Universal Belted CRS

Maxi Cosi Cabriofix (Belt)



Maxi Cosi Cabriofix &amp; EasyFix (Belt)



Britax Römer King II LS (Belt)



Cybex Solution Z i-Fix (Belt)





## CHILD OCCUPANT

Total 40.1 Pts / 81%

	Seat Position			
	Front	2nd row		
		PASSENGER	LEFT	RIGHT
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	—		●	●
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	—		●	●
BeSafe iZI Kid X2 i-Size (i-Size)	—		●	●
Britax Römer TriFix2 i-Size (i-Size)	—		●	●
BeSafe iZI Flex FIX i-Size (i-Size)	—		●	●
BeSafe iZI Combi X4 ISOFIX (ISOFIX)	—		●	●
Cybex Solution Zi-Fix (ISOFIX)	—		●	●
Maxi Cosi CabrioFix (Belt)	●		●	●
Maxi Cosi CabrioFix & EasyFix (Belt)	●		●	●
Britax Römer King II LS (Belt)	●		●	●
Cybex Solution Zi-Fix (Belt)	●		●	●

● Install without problem    ● Install with care    ● Safety critical problem    ✗ Installation not allowed

— Not available

## Comments

In the side barrier impact, measurements of accelerations in the head of the 10-year dummy indicated weak protection. Otherwise, protection of all critical body areas was good, both for the 10-year and 6-year dummies. The front passenger airbag can be disabled to allow a rearward-facing child restraint to be used in that seating position. Clear information is provided to the driver regarding the status of the airbag and the system was rewarded. All of the restraint types for which the 2 Series Coupé is designed could be properly installed and accommodated in the car.



## VULNERABLE ROAD USERS

Total 36.6 Pts / 67%

 GOOD ADEQUATE MARGINAL WEAK POOR

## Pedestrian

27.0 / 36 Pts



Head Impact	20.9 Pts
Pelvis Impact	0.9 Pts
Leg Impact	5.2 Pts

## Vulnerable Road Users

9.6 / 18 Pts

System Name	Pedestrian Warning with City Braking Function
Type	Auto-Brake with Forward Collision Warning
Operational From	5 km/h




## VULNERABLE ROAD USERS

Total 36.6 Pts / 67%


## AEB Pedestrian

## ■ Day time

Vehicle reversing into standing pedestrian

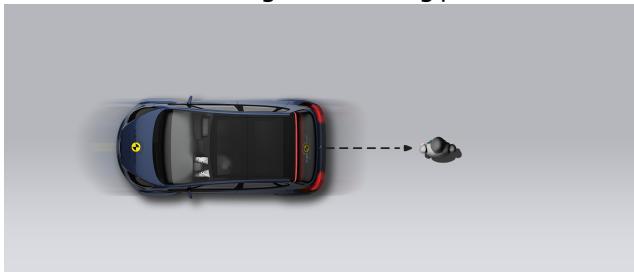


Pedestrian crossing a road into which a car is turning

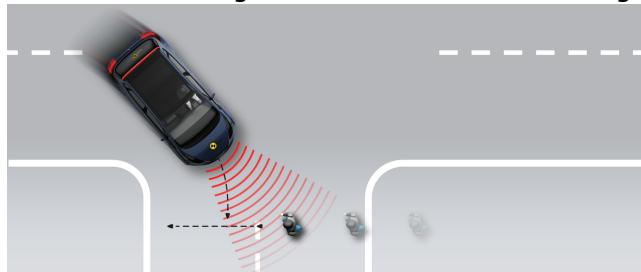


Adult crossing the road



Child running from behind parked vehicles

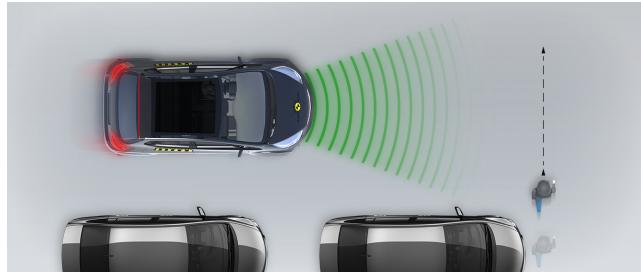

Adult along the roadside

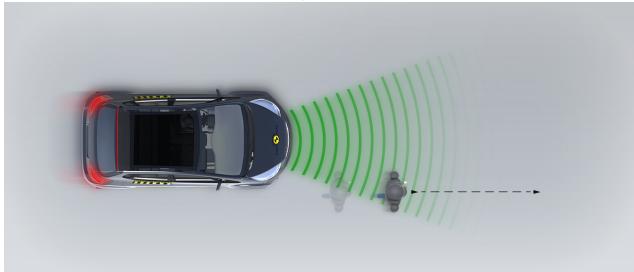


## ■ Night time

Adult crossing the road



Adult along the roadside

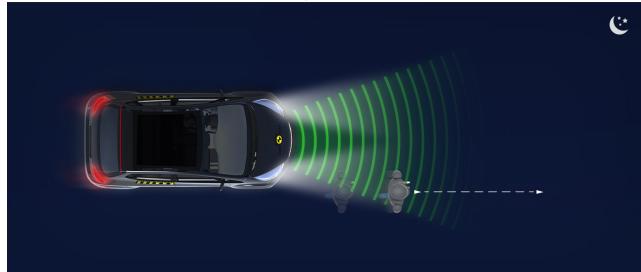



## VULNERABLE ROAD USERS

Total 36.6 Pts / 67%


## AEB Cyclist

4.0 / 9 Pts

Cyclist from nearside, obstructed view



Cyclist crossing

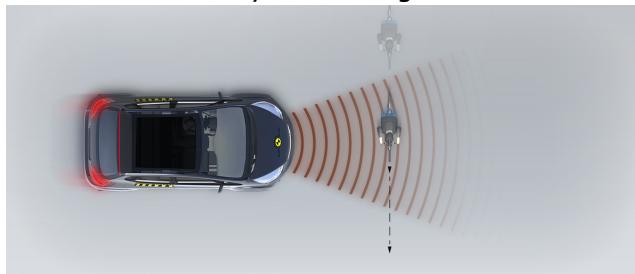

Cyclist along the roadside



## Comments

The 2 Series Coupé has an 'active' bonnet. Sensors in the bumper detect when a pedestrian has been struck and actuators lift the bonnet to provide greater clearance to stiff structures in the engine compartment. BMW demonstrated that the system worked robustly for different pedestrian statures and across a wide range of speeds, so the car was tested with the bonnet in the raised, deployed position. Head protection was good over almost the entire surface of the bonnet. The bumper provided good protection to pedestrians' legs at all but the very outermost test points. However, protection of the pelvis was almost entirely poor. The autonomous emergency braking system, fitted as standard, can detect vulnerable road users as well as other vehicles. The system performed adequately in tests of its reaction to pedestrians, with collisions avoided or mitigated in many scenarios. The system's performance was marginal when in tests of its response to cyclists.

 **SAFETY ASSIST**

Total 10.2 Pts / 64%


**Speed Assistance**


System Name	Speed Limit Assist
Speed Limit Information Function	Camera & Map, subsigns supported
Speed Limitation Function	System advised (accurate to 5km/h)

**Occupant Status Monitoring**

> **Seatbelt Reminder**


Applies To	Front and rear seats		
	Driver Seat	Front Passenger(s)	Rear Passenger(s)
Warning			
Visual	●	●	●
Audible	●	●	●
Occupant Detection	—	●	—

 Pass  
  Fail  
 — Not available

> **Driver Monitoring**


System Name	Attentiveness Assistant
Type	Steering input
Operational From	70 km/h

 **SAFETY ASSIST**

Total 10.2 Pts / 64%

**Lane Support**
 **1.8 / 4 Pts**

System Name	Lane Departure Warning	
Type	LKA and ELK	
Operational From	70 km/h	
<b>PERFORMANCE</b>		
Emergency Lane Keeping		MARGINAL
Lane Keep Assist		GOOD
Human Machine Interface		GOOD

**AEB Car-to-Car**
 **3.7 / 6 Pts**

System Name	Collision Warning with Braking Function	
Type	Autonomous emergency braking and forward collision warning	
Operational From	5 km/h	
Sensor Used	camera and radar	



## SAFETY ASSIST


Total 10.2 Pts / 64%

## ■ Autobrake function only


Test car turns across the path of an approaching car



Approaching a stationary car

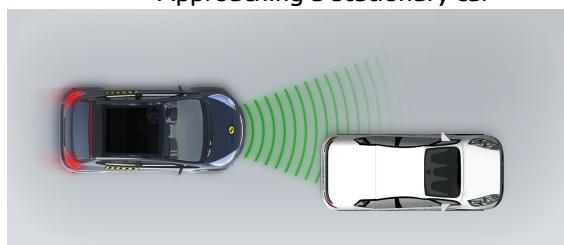


Approaching a stationary car

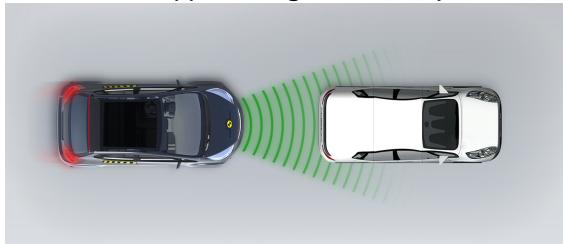


Approaching a stationary car




Approaching a slower moving car

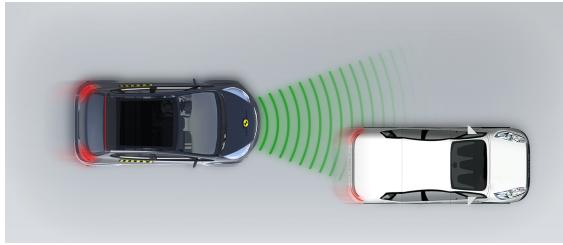


Approaching a slower moving car

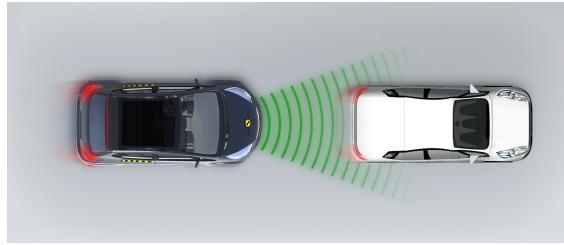

Approaching a slower moving car

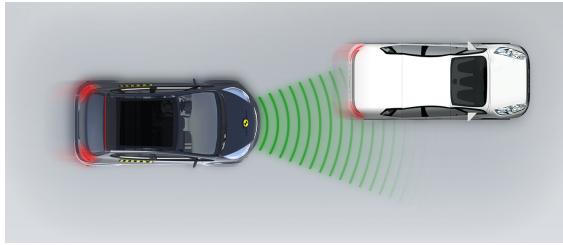

Approaching a braking car

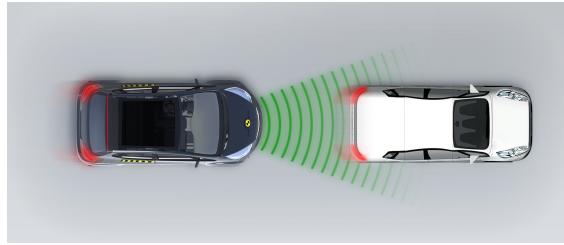




## SAFETY ASSIST


Total 10.2 Pts / 64%

## ■ Driver reacts to warning


Approaching a stationary car

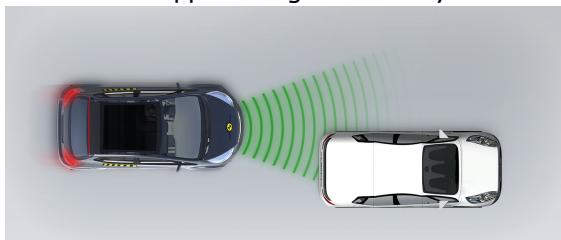


Approaching a stationary car

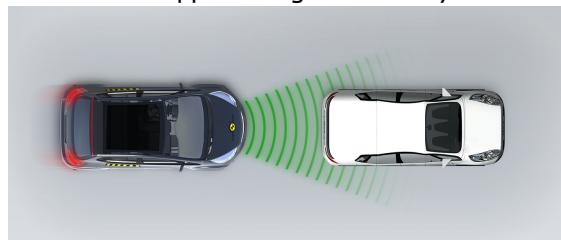


Approaching a stationary car

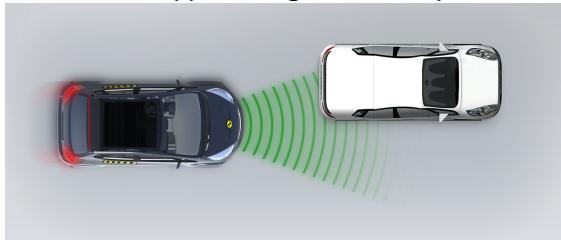


Approaching a slower moving car

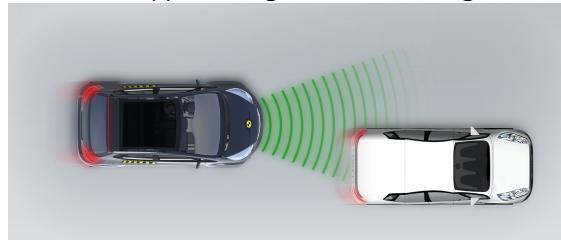


Approaching a slower moving car

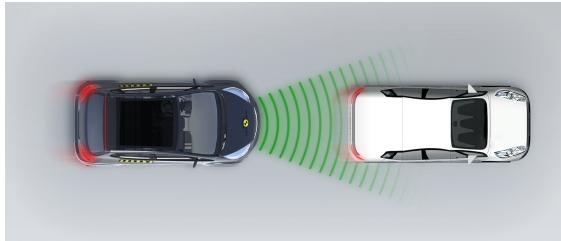

Approaching a slower moving car

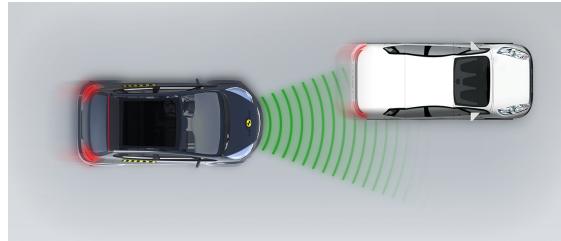

Approaching a braking car

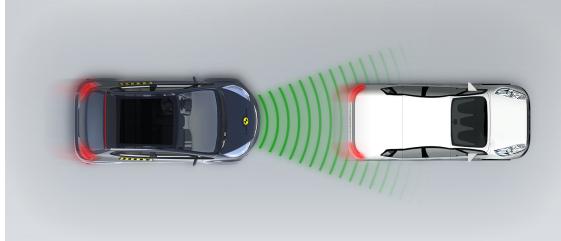



## SAFETY ASSIST

Total 10.2 Pts / 64%

## Comments

In tests of its response to other vehicles, the autonomous emergency braking system performed adequately. A lane support system gently corrects the steering if the car is drifting out of lane and it can also intervene more aggressively in some other, more critical, situations. The speed assistance system can detect the local speed limit and presents the information to the driver, allowing the speed limiter to be set appropriately. A seatbelt reminder is standard for all seating positions.

**RATING VALIDITY****Variants of Model Range**

Body Type	Engine	Model Name	Drivetrain	Rating Applies	
				LHD	RHD
2 door coupe	2.0L, 4-cylinder diesel	220d sDrive*	4 x 2	✓	✓
2 door coupe	2.0L, 4-cylinder petrol	220i sDrive	4 x 2	✓	✓
2 door coupe	2.0L, 4-cylinder petrol	230i sDrive	4 x 2	✓	✓
2 door coupe	3.0L, 6-cylinder petrol	240i MPA sDrive	4 x 2	✓	✓
2 door coupe	3.0L, 6-cylinder petrol	240i MPA xDrive	4 x 4	✓	✓

\* Tested variant

**Annual Reviews and Facelifts**

Date	Event	Outcome
March 2022	Rating Published	2022  ✓